



Aug.1.2024 Copyright 2024 HIROSE ELECTRIC CO., LTD. All Rights Reserved.
In case of consideration for using Automotive equipment / device which demand high reliability, kindly contact our sales window correspondents.

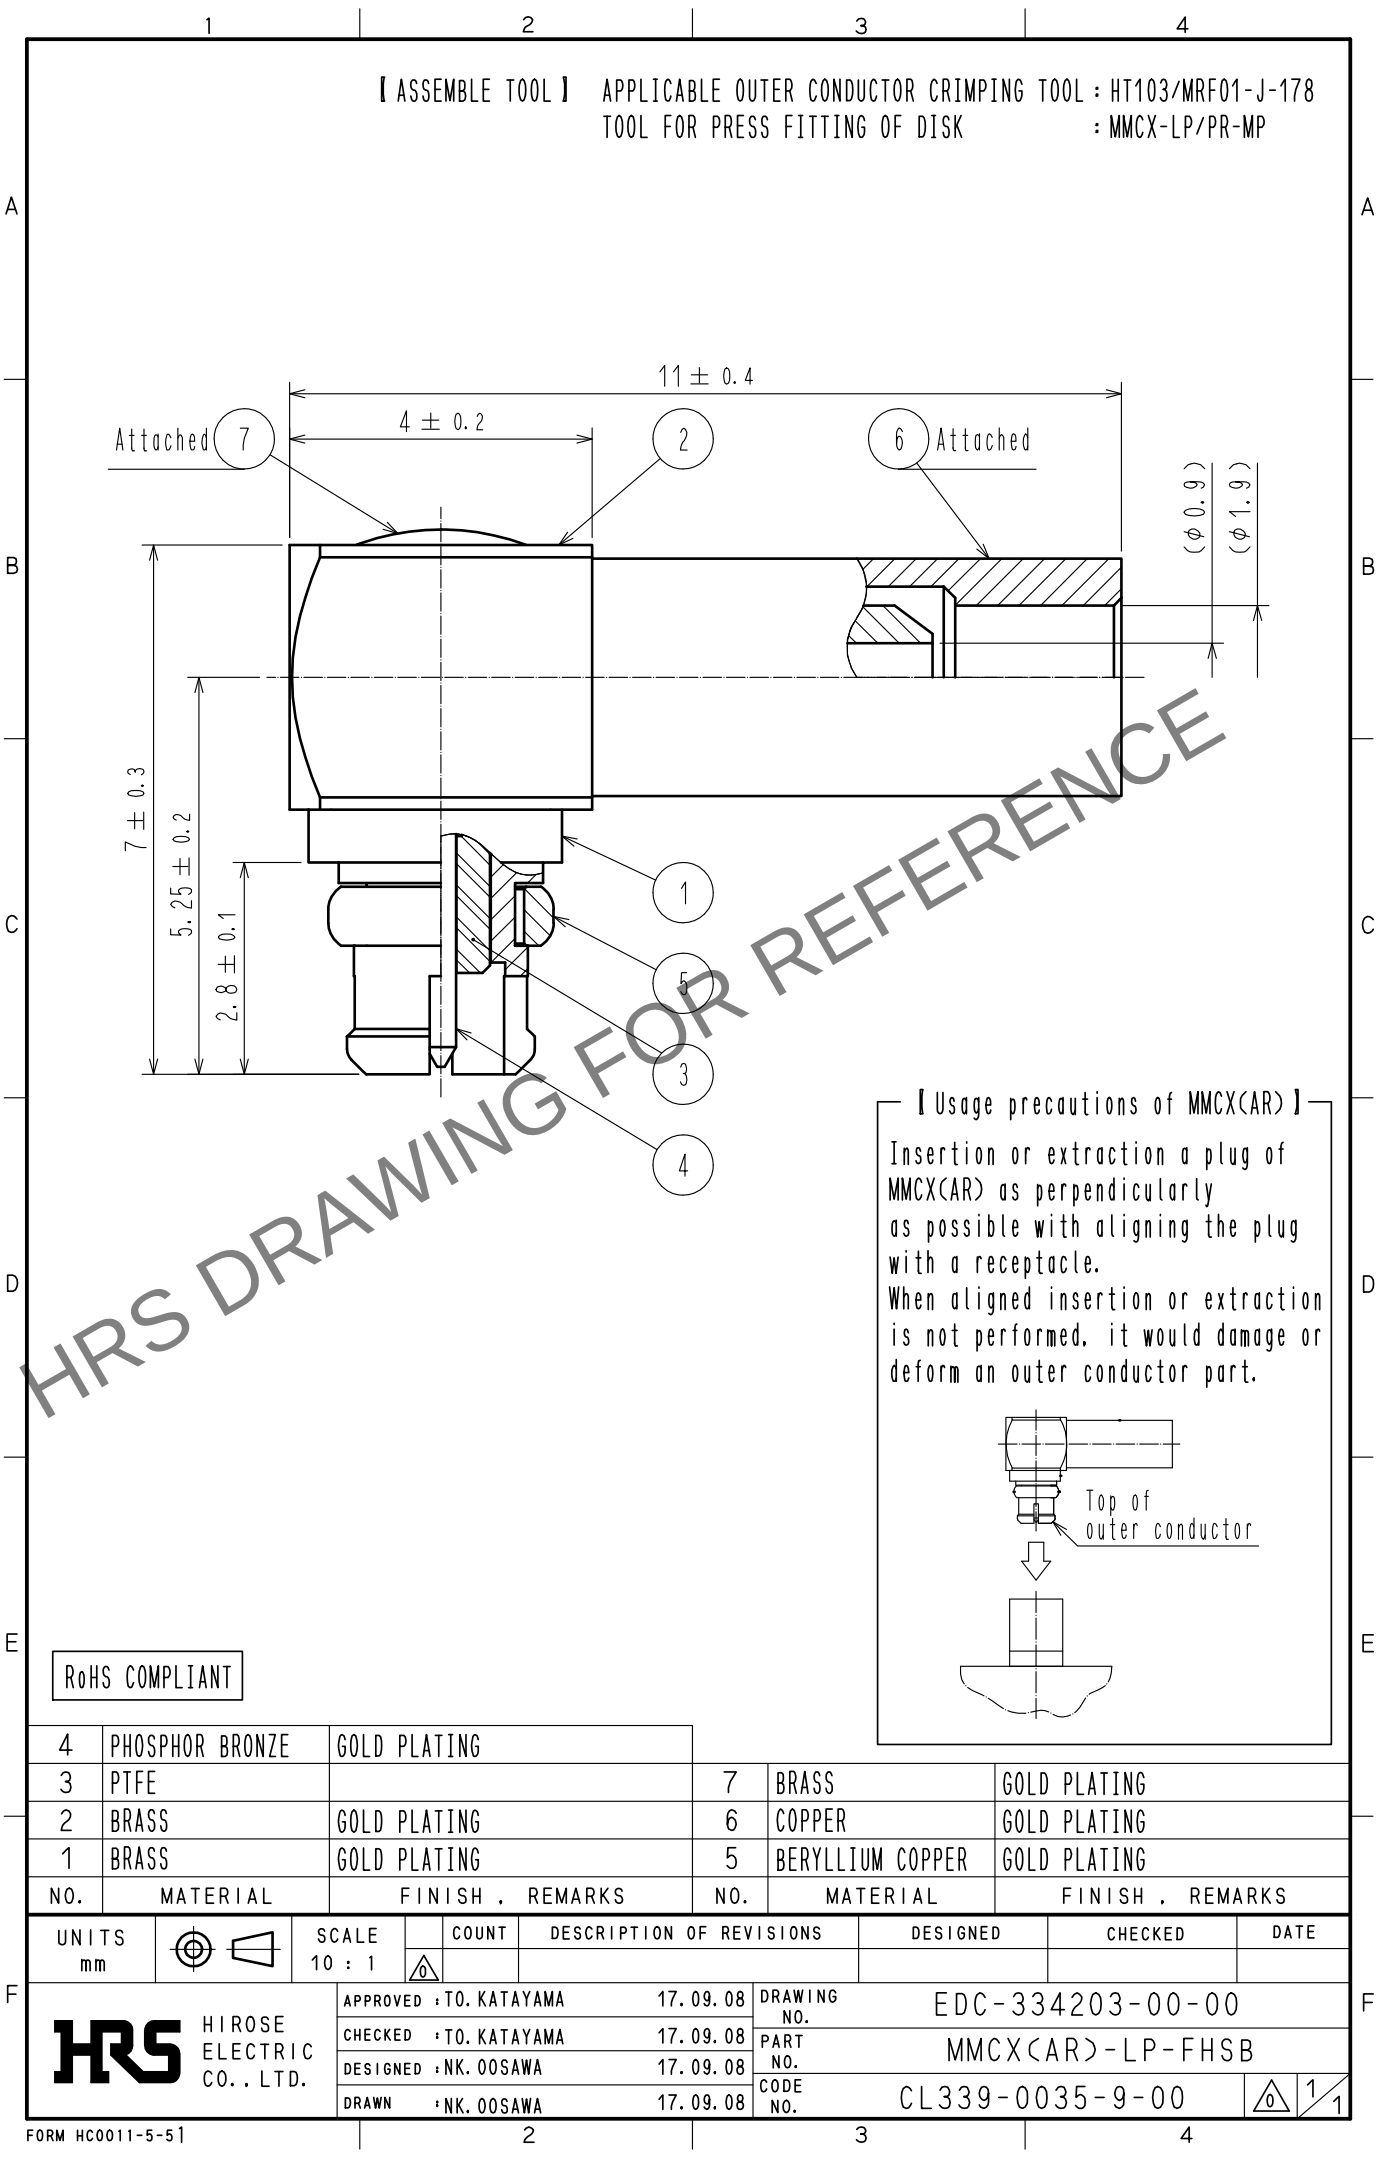

【 Usage precautions of MMCX<AR> 】
Insertion or extraction a plug of MMCX<AR> as perpendicularly as possible with aligning the plug with a receptacle.
When aligned insertion or extraction is not performed, it would damage or deform an outer conductor part.

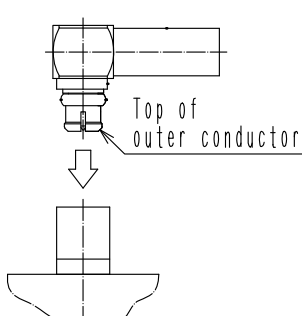

RoHS COMPLIANT

4	PHOSPHOR BRONZE	GOLD PLATING			
3	PTFE		7	BRASS	GOLD PLATING
2	BRASS	GOLD PLATING	6	COPPER	GOLD PLATING
1	BRASS	GOLD PLATING	5	BERYLLIUM COPPER	GOLD PLATING
NO.	MATERIAL	FINISH . REMARKS	NO.	MATERIAL	FINISH . REMARKS

UNITS mm		SCALE 10 : 1	COUNT 	DESCRIPTION OF REVISIONS	DESIGNED	CHECKED	DATE
APPROVED : TO. KATAYAMA 17. 09. 08				DRAWING NO. EDC-334203-00-00			
CHECKED : TO. KATAYAMA 17. 09. 08				PART NO. MMCX<AR>-LP-FHSB			
DESIGNED : NK. OOSAWA 17. 09. 08				CODE NO. CL339-0035-9-00			
DRAWN : NK. OOSAWA 17. 09. 08				1/1			